

Service Bulletin

Maintenance of Way Equipment

Date: 10.15.2026**RRP Service Bulletin No:** RRP SB408**Title:** Inspect AAM Turntable Cylinder RRP# 472500 Welds**Rating:****ALERT**

(Potential Problem)

**INFORMATION**

(Action Is Optional)

**DIRECTIVE**

(Action Is Required)

**PRODUCT IMPROVEMENT**

(Enhance Product)

Product Series: Advanced Anchormatic [AAM]**Serial No:**

AAM-002-17	915572	UPRR	AAA-1701
AAM-003-17	915572	UPRR	AAA-1702
AAM-004	915572	UPRR	AAA-1801
AAM-005	915572	UPRR	AAA-1802
AAM-006	915572	UPRR	AAA-1803

AAM-018	931572	UPRR	AAA-2001
AAM-019	931572	UPRR	AAA-2002
AAM-020	931572	UPRR	AAA-2003
AAM-021	931572	UPRR	AAA-2004

AAM-001-16	915572	CN	
AAM-014	945572	CN-S	68516

AAM-017	930572	DEMO	
---------	--------	------	--

AAM-008	915572	UPRR	AAA-1901
AAM-009	915572	UPRR	AAA-1902
AAM-010	915572	UPRR	AAA-1903
AAM-011	915572	UPRR	AAA-1904
AAM-012	915572	UPRR	AAA-1905
AAM-013	915572	UPRR	AAA-1906

AAM-023	931572	UPRR	AAA-2301
AAM-024	931572	UPRR	AAA-2302
AAM-025	931572	UPRR	AAA-2303

AAM-015	935572	CN-W	68515
AAM-016	935572	CN-W	68514

Summary: Possible cracking/fatigue failure on the RRP# 472500 Turntable Cylinder Welds.




Action: Inspect the welds on the turntable cylinder RRP# 472500 between the mounting plate and cylinder body for cracking/fatigue failure (see drawing for location).

Completion / Resolution: If there is cracking / fatigue, replace the cylinder.

If there is no damage, continue with normal machine operation.

Check the welds annually for cracking and fatigue.

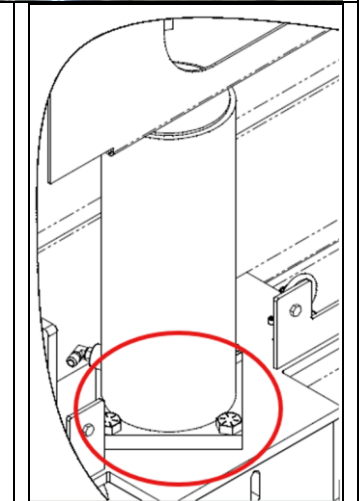

Contact: If you have any questions or we can be of any service, please contact the Racine Railroad Products Service Department at (262)-637-9681 or fieldservice@racinerailroad.com.